

(F)19-R Rim Device with FSA or FSE Feature


Metal Door, LHR Shown, RHR Opposite

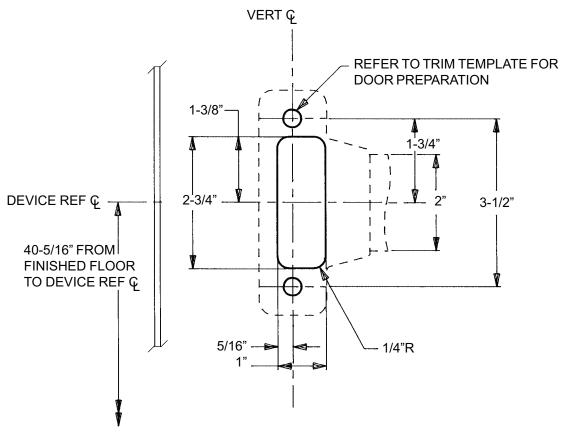

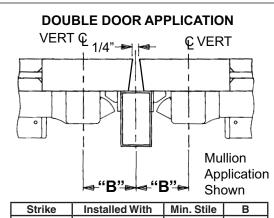

Strike	Installed With	Min. Stile	В
565	2923 Mullion	4"	2¾"
565	4023 Mullion	41/4"	3"
570	2923 Mullion	41/4"	3"
570	4023 Mullion	41/2"	31/4"
579	2923 Mullion	35/8"	2%"
579	4023 Mullion	37/8"	25/8"
490	2923 Mullion	41/4"	3"
490	4023 Mullion	41/2"	31/4"
F-570	F-4023 Mullion	41/2"	31/4"
F-490	F-4023 Mullion	41/2"	31/4"
571	18/XX Vertical	41/8"	27/8"
571-A	18/XX Vertical	35%"	2%"

Note: 571 and 571-A strikes are not approved for fire rated applications.

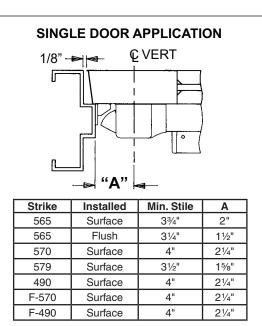

- For outside trim, see trim template for door preparation.
- See Master Sheet #0100 for suggested reinforcing.

TEMPLATE

T-5100-a